SENT

## BEST COPY AVAILABLE



PP UHPJD


DE LA254/UWLX 01

P 282247Z

FM HOLMES AND NARVER LOSA

TO HOLMES AND NARVER ENIWETOK

AEC GRNC

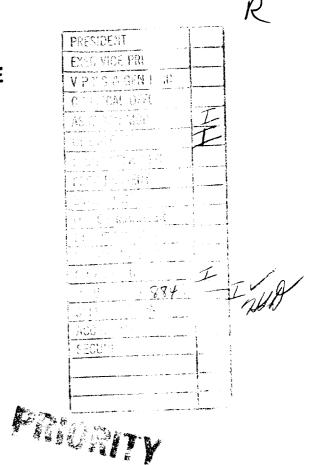

HOW NAN EIGHT FIVE EIGHT PD BOETTCHER FROM DIETZE PBD REUR ENGMSG SIX
FOUR ONE EIGHT PD CRANE HOIST ENGR ADVISES HOIST OPERATION YOU DESCRIBE
NOT NORMAL PD HOIST IS EQUIPPED WITH MECHANICAL LOAD BRAKE BUILT INTO
QUOTE DORRIS UNQUOTE SPEED REDUCER PD THIS BRAKE EVIDENTLY IS NOT
FUNCTIONING PROPERLY PD COVER MUST BE REMOVED FROM SPEED REDUCER TO
CHECK OPERATION OF LOAD BRAKE AND TO ADJUST BRAKE PD IF SPEED REDUCER IS
FOUND TO BE DAMAGED BEYOND REPAIR AT JOBSITE CMM SPEED REDUCER FROM ANY
OTHER CRANE HOIST MACHINE AT JOBSITE CAN BE SUBSTITUTED PENDING
DELIVERY OF REPLACEMENT SPEED REDUCER PD ALL CRANE HOIST SPEED REDUCERS
ARE IDENTICAL AND AVAILABLE FROM LOSA STOCK FD WILL DEFER PLACING

NATIONAL ARCHIVES
REPOSITORY PACIFIC SOUTHWEST REGION

COLLECTION RG 326 ATOMIC ENERGY COMMISSION

BOX No. 199624 (#608) A16334 326-65voite

ELMER GENERAL

FOLDER JOB 884 PROJECT ENGINEERING FILE

850

## Reproduced from the holdings of the National Archives Pacific Southwest Region

P
A
GE TWO UWLX 01

ORDER FOR NEW SPEED REDUCER OR SPARE PARTS PENDING REPLY FROM YOU 28/2255Z